




1. USE SNAP TRACK TRAY COVER ONLY IF LESS THAN 3' ABOVE WORKING SURFACE. TRAY SHOULD BE COVERED FOR 3' MINIMUM.
2. SNAP TRACK CABLE CLAMPS TO BE USED TO SECURE CABLES.
3. SNAP TRACK HOLD DOWN CLAMPS (STHC-2-AL) TO BE ATTACHED TO STRUT USING 1/2" SS BOLT, FLAT WASHER AND SPRING/STRUT NUT. ALSO CAN BE BOLTED THROUGH WITH A HEX NUT.

BILL OF MATERIALS

ITEM	QTY	DESCRIPTION
1	AS REQ'D	STC-2-2-AL-V2 - SNAP TRACK CABLE TRAY- 2" X 2" X 20'L - ALUMINUM
2	AS REQ'D	STCV-2-AL - SNAP TRACK COVER - 2" X 10'L - ALUMINUM
3	AS REQ'D	STWC-2-AL - SNAP TRACK 2" WIRE CLAMPS, RUBBER COATED W/ PUSHPIN
4	2	STBE-2-2-AL - SNAP TRACK BLIND END PLATE - 2" X 2" - ALUMINUM
5	1	STCT-2-2-AL-6R - SNAP TRACK TEE - 2" X 2" X 6"R - ALUMINUM
6	1	STHE-2-2-AL-6R - SNAP TRACK HORIZONTAL ELBOW - 2" X 2" X 6"R - ALUMINUM
7	AS REQ'D	STHC-2-AL - SNAP TRACK HOLD DOWN CLAMP - ALUMINUM
8	2	1/2" LIQUID TIGHT CONNECTOR - MALE STRAIGHT
9	AS REQ'D	1/2" LIQUID TIGHT FLEXIBLE CONDUIT

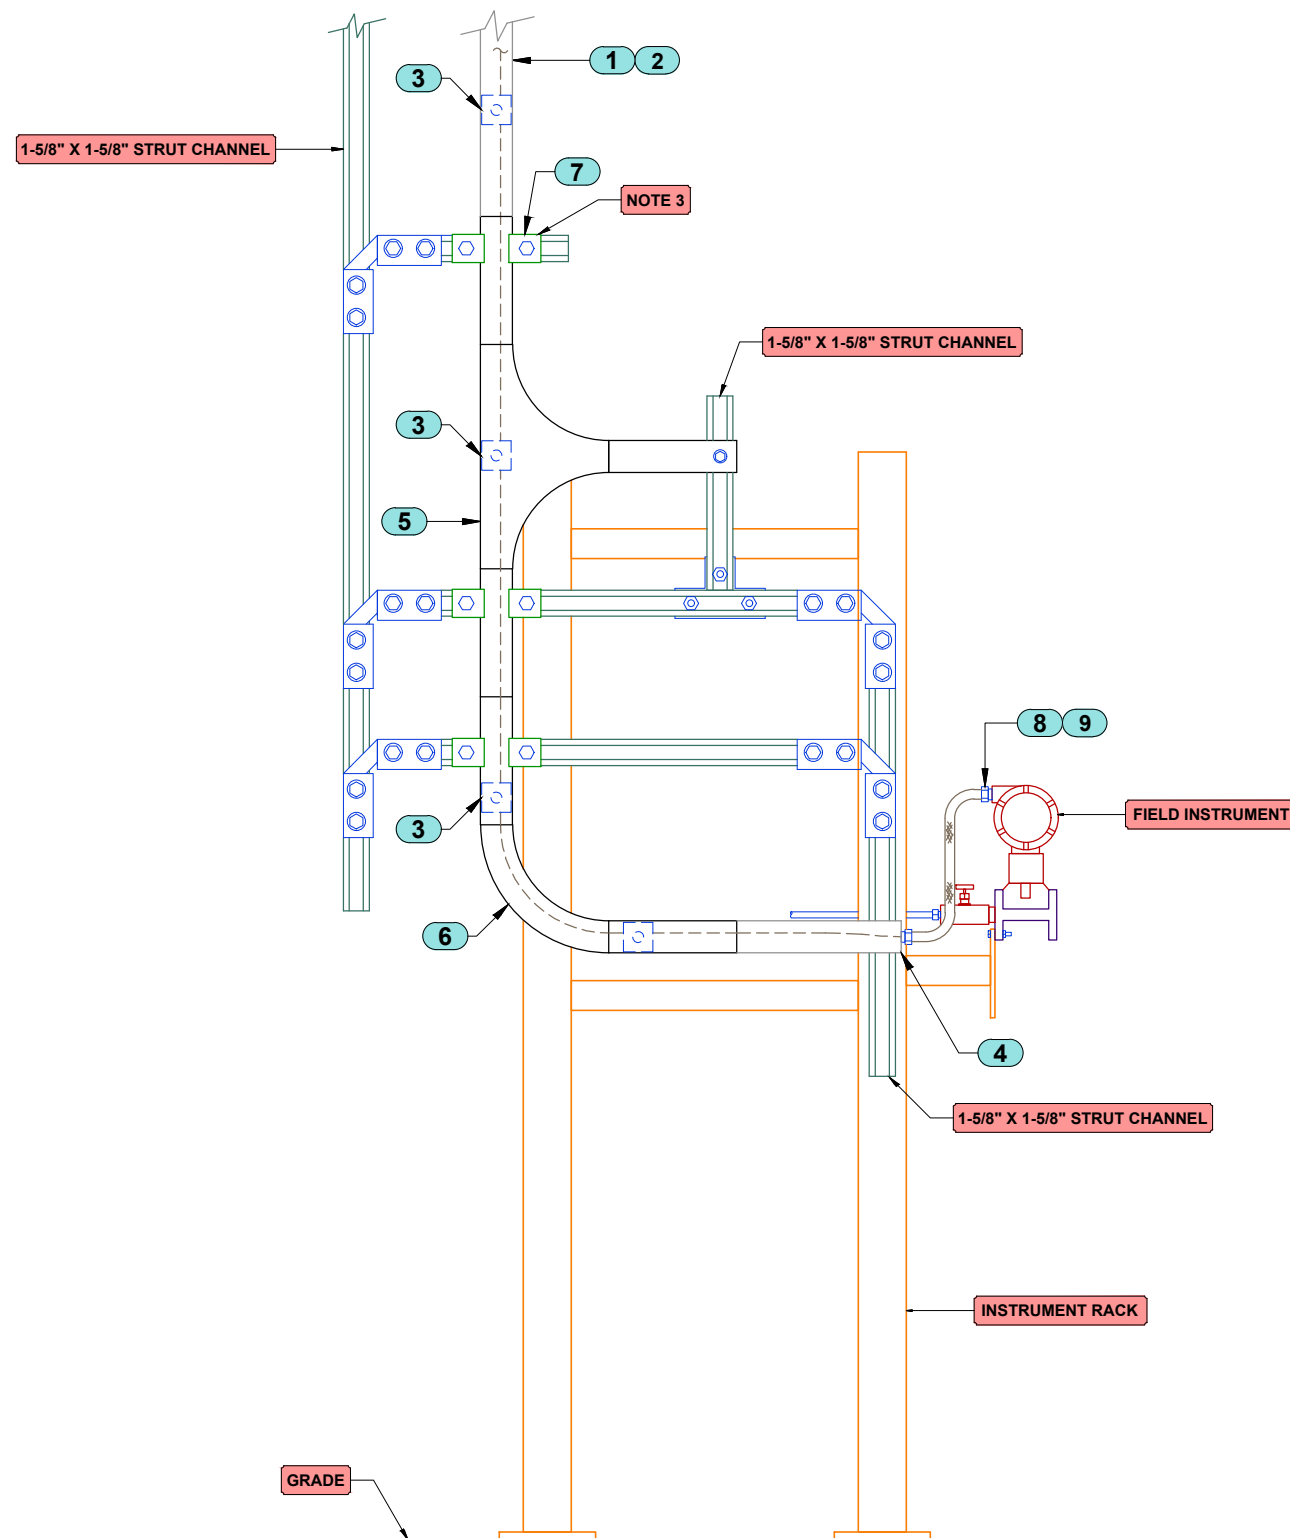